

RBR *legato*³ INSTRUMENT GUIDE



rbr-global.com

Table of contents

1	RBR <i>legato</i> ³	3
2	Physical specifications.....	4
3	Sensor specifications	6
3.1	Conductivity, temperature, and pressure	6
3.2	RBR <i>coda</i> ³ T.ODO	7
3.3	RBR <i>quadrante</i>	8
3.4	RBR <i>tridente</i>	10
3.5	Transmissometer	11
4	Derived parameters	12
4.1	Salinity	12
4.2	Specific conductivity.....	12
4.3	Speed of sound	13
4.4	Sea pressure	13
4.5	Depth	13
4.6	Oxygen saturation.....	13
5	Maintenance.....	14
5.1	RBR <i>tridente</i> safety precautions	14
5.2	RBR <i>coda</i> ³ T.ODO care and maintenance.....	15
5.3	Cleaning.....	17
5.4	Cables and connectors	19
5.5	Calibration.....	20
5.6	Repairs.....	20
6	Revision history	20

1 RBRlegato³

The RBRlegato³ is a small CTD instrument optimised for gliders and autonomous underwater vehicles. Designed to determine salinity by measuring the conductivity, temperature, and pressure, it can also incorporate a variety of sensors, such as optical dissolved oxygen, photosynthetically active radiation, turbidity, backscatter, and more. Its rugged inductive cell is not affected by surface contaminants or freezing conditions. The co-located thermistor reduces salinity spiking, thus increasing data accuracy. Equipped with a piezoresistive pressure channel, the RBRlegato³ provides more accurate salinity data when the instrument is sampling at varying depths. The instrument ensures totally silent operation for passive acoustic listening and turbulence measurements, and is rated to the depth of 1000m.

The RBRlegato³ comes in two variants:

- RBRlegato³ C.T.D - 2Hz, standard thermistor response, realtime data output
- RBRlegato³ C.T.D | fast16 - 16Hz, fast thermistor response, realtime data output

Key features of the RBRlegato³ C.T.D are:

- High accuracy
 - Unaffected by surface contaminants
 - Pre-calibrated to account for static elements
 - Sampling rate up to 16Hz
- Low power
 - 90% less power than pumped CTD
 - Longer mission and more samples
- Silent operation
 - No pump or moving parts
 - Reduced noise for acoustic measurements
 - Reduced vibration for turbulence studies



2 Physical specifications

Instrument

Parameter	Value
Maximum number of readings*	240 million
External power	4.5V to 30V
Communications	RS-232
Clock drift**	±60 seconds per year
Depth rating	1000m
Housing material	Plastic
Dimensions	195.8mm x 63.8mm x 78.6mm
Top curvature, selectable	Ø220mm or Ø124mm
Weight (in air)	0.8kg
Weight (in water)	0.2kg
Displacement	600cm ³

*Each sample can include multiple readings.

**The realtime clock is not maintained when there is no power.



Power consumption

Parameter	Value
≤1Hz sampling	22.8mJ per sample
≥2Hz sampling	46mW
Sleep power	180μW
Typical peak inrush current	6.6A (15μs duration)

Startup time

Generally, there is no need to power off RBR instruments. The *RBRlegato³* will go to sleep after inactivity, consume virtually no power while on standby, and then wake up instantly when required.

If you turn off the instrument, there will be a delay starting up. Furthermore, you will have to wait for at least two minutes before turning it back on.

- Elapsed startup time from fully discharged state to functional command interpreter: 4s maximum
- Elapsed power downtime to complete discharge: 120s minimum


⚠ Ensure that the instrument is fully discharged before resuming the measurements. Power-cycling the unit for less than 120s may leave the board in an unknown state. In addition, the realtime clock may not be maintained over a power cycle.

External port

The *RBRlegato³* uses an external MCBH-6-MP connector. It can be used for connecting to an RS-232 underwater extension cable.



External MCBH-6-MP connector pinout

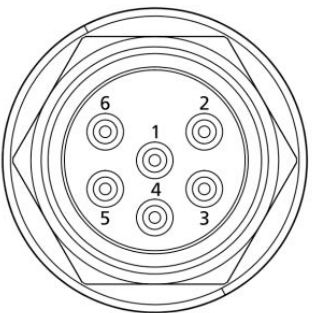	Pin No.	RS-232
	1	Ground
	2	Power 4.5V to 30V
	3	Data output from the instrument (Tx)
	4	Data input into the instrument (Rx)
	5	N/C
	6	N/C


3 Sensor specifications

The RBR*legato*³ C.T.D is a multi-channel instrument with conductivity, temperature, and pressure sensors installed by default. Additionally, it supports several optional sensors:

- Optical dissolved oxygen (ODO): [RBR*coda*³ T.ODO](#)
- Photosynthetically active radiation (PAR), narrow-band radiometers (rad): [RBR*quadrante*](#)
- Turbidity (Tu), backscatter (bb), chlorophyll *a*, fluorescence (Fl): [RBR*tridente*](#) or ECO-puck (Sea-Bird®)
- Transmittance: [C-star](#) (Sea-Bird®)
- pH: RBR sensor only (release pending)

3.1 Conductivity, temperature, and pressure

The RBR*legato*³ C.T.D integrates conductivity, temperature, and pressure sensors in one uniquely designed body, optimised for flow dynamics.

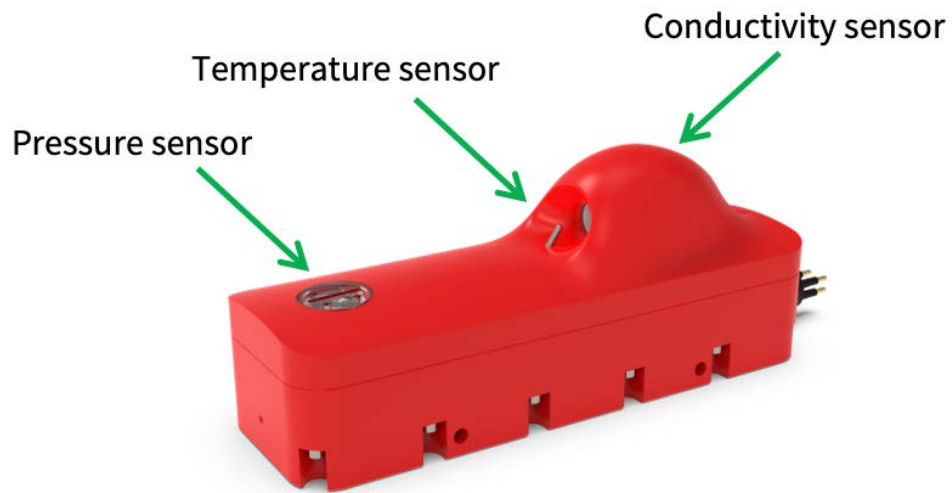

Conductivity sensor

Parameter	Value
Range	0 to 85mS/cm
Initial accuracy	±0.003mS/cm
Resolution	<0.001mS/cm
Typical stability	±0.010mS/cm per year

⚠ Accuracy of conductivity measurements is affected by objects within 15cm of the sensor, especially if they are conductive. Metal deployment frames are a good example. This proximity effect decreases with distance. Calibration procedure uses the predetermined k-factor to take into account static elements, such as other sensors or glider body.

Temperature sensor


Parameter	Value
Range	-5°C to 42°C
Initial accuracy	±0.002°C (-5 to +35°C) ±0.004 °C (+35 to +42 °C)
Resolution	0.00005°C
Typical stability	±0.002°C/year
Time constant	<1s (standard) <0.1s (fast16)

Pressure sensor

Parameter	Value
Range	1000dbar
Initial accuracy	±0.05% full scale
Resolution	<0.001% full scale
Typical stability	±0.05% full scale
Time constant	<0.01s

3.2 RBRcoda³ T.ODO

The RBR*legato*³ can integrate the RBR*coda*³ T.ODO sensors. The measurement principle of optical dissolved oxygen sensors is based on the luminescence quenching by oxygen.

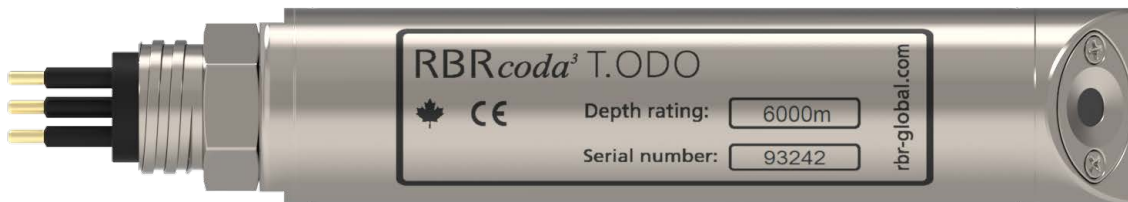

RBRcoda³ T.ODO

Parameter	Value
Measurement range	0-1000µmol/L
Calibrated range Concentration Saturation Temperature	0-500µmol/L 0-120% 1.5°C to 30°C
Initial accuracy For 1s For 8s, 30s	Maximum of ±8µmol/L or ±5% Maximum of ±2µmol/L or ±1.5%
Resolution For 1s For 8s, 30s	<1µmol/L (saturation 0.4%) <0.5µmol/L (saturation 0.2%)
Time constant	<1s, <8s, or <30s

⚠ Optical dissolved oxygen measurements require pressure correction for highest accuracy. When installed on an instrument with a pressure sensor, this correction is done automatically. If installed on a moored instrument with no pressure sensor, enter the known depth value manually in the table under the **Parameters** tab in Ruskin.

Store the sensor in the dedicated storage cap, included with the instrument. Rehydrate for five days before deployment. See [RBRcoda³ T.ODO care and maintenance](#) for more information.

3.3 RBRquadrante

The RBRlegato³ can integrate the RBRquadrante sensors. This four-channel radiometer supports multiple radiation measurements (combinations of PAR and rad sensors) within the same sensor package.



RBRquadrante

Optical radiometry

Parameter	Value
Dynamic range	>5.5 decades (nominal)
Absolute calibration*	±5%
Linearity	±1%
Operating temperature range	-5°C to 35°C
Cosine response error (water)	±5% at 0-60°C , ±10% at 61-82°C
Azimuth error (water)	±1.5% at 45°C
Out-of-band rejection**	>25dB (typical), OD 2.5

* RBR calibrates radiometers with NIST traceable references.

** Out-of-band rejection is wavelength-dependent for narrow-band radiometers.

PAR


Parameter	Value
Wavelength range	400nm to 700nm
Full scale range	0 to 5000µmol/m ² /s (minimum)
Resolution	±0.010µ mol/m ² /s

Narrow-band channels

Parameter	Value
Centre wavelengths (CWL)*	413 / 445 / 475 / 488 / 508 / 532 / 560nm
Full width at half-maximum (FWHM)	10nm (25nm for CWL 475nm)
Full scale range	0 to ≥200µW/cm ² /nm (full sun)
Resolution**	±0.001µW/cm ² /nm

* Other CWL options within the 400-1100nm range are available upon request. Contact RBR for more information.

** Resolution is wavelength-dependent for narrow-band radiometers.

 Dark offset is internally temperature-compensated.

3.4 RBRtridente

The RBR*legato*³ can integrate the RBR*tridente* sensors.

The RBR*tridente* is an optical sensor with three channels, capable of making multiple fluorescence and backscatter or turbidity measurements simultaneously. Its standard depth rating is 2000m, but a 6000m variant is available upon request. Contact RBR for more information.



RBRtridente

Optical

Parameter	Value
Centroid angle	120°
Sensing volume	~1.3mL
Linearity, R ²	0.99
Calibration accuracy	5%

Chlorophyll *a*

Parameter	Value
Channel wavelength (excitation/emission)	470nm/695nm
Calibrated range*	0-50µg/L
Detection limit*	0.01µg/L

* Scaled to the fluorescence response from a monoculture of *Thalassiosira weissflogii*.

fDOM*

Parameter	Value
Channel wavelength (excitation/emission)	365nm/450nm
Calibrated range	0-500ppb
Detection limit	0.03ppb

* fDOM can be used as a proxy for cDOM.

Backscatter

Parameter	Value
Channel wavelength	470/525/650/700nm
Calibrated range*	0-0.05m ⁻¹ sr ⁻¹
Detection limit	1x10 ⁻⁶ m ⁻¹ sr ⁻¹

* Response becomes non-linear above 0.05m⁻¹sr⁻¹.


Turbidity

Parameter	Value
Channel wavelength	700nm
Calibrated range*	0-500FTU
Detection limit	0.001FTU

* Response becomes non-linear above 500FTU.

3.5 Transmissometer

The RBR*legato*³ can integrate the the Sea-Bird transmissometer (C-Star).

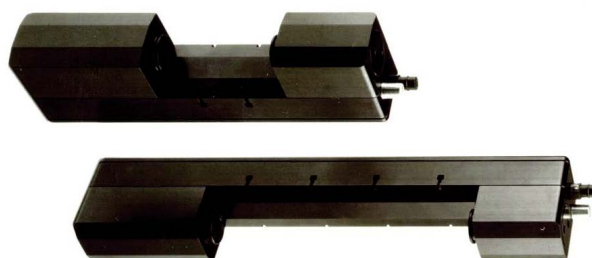

Transmissometers

Parameter	Value
Wavelengths	410 / 465 / 520 / 650nm
Bandwidth	~10-12nm for 370nm ~20nm for all other wavelengths
Pathlength	25 or 10cm
Acceptance angle	~1°
Bandwidth	~10-12nm for 370nm ~20nm for all other wavelengths
Linearity	99% R ²
Depth rating	600m (plastic), 6000m (aluminium)


4 Derived parameters

All derived parameters will be calculated on the instrument. The RSK file will store the data with calibration coefficients already applied and derived parameters already calculated.

4.1 Salinity

Salinity is defined as the ratio of the mass of dissolved material to the mass of seawater. It is impossible to measure absolute salinity directly. However, we can derive practical salinity from measurable properties: electrical conductivity, temperature, and pressure, obtained by your *RBRlegato*³ C.T.D. The units of measurement are **PSU** (dimensionless Practical Salinity Units).

RBR uses the algorithm recommended by PSS78, the world standard for practical salinity calculation. It enables calculation of practical salinity in a range 2 to 42PSU from conductivity S (mS/cm) measured at temperature T (°C) and hydrostatic pressure p (dBar). Refer to [Practical Salinity Scale of 1978 \(PSS78\)](#) for more details.

 If the PSS78 calculation generates an error, the instrument will report a salinity of 0. This might occur when, in air, the conductivity report a small negative value. This does not apply if one of the measured parameters is already flagged as an error.

4.2 Specific conductivity

Specific conductivity is a function of conductivity and temperature. This parameter is mostly applicable in studies of freshwater and brackish water. The units of measurement are **µS/cm** (microsiemens per centimetre).

RBR uses the algorithm described in [Standard Methods for the Examination of Water and Wastewater](#) by L.S. Clesceri et al, which yields specific conductivity normalised to 25°C.

$$\text{Specific conductivity} = \frac{0.001 \cdot \text{conductivity}}{1 + 0.0191(\text{temperature} - 25)}$$

where conductivity in mS/cm and temperature in °C are values measured by your *RBRlegato*³, and 0.0191 is the default specific conductivity coefficient.

The specific conductivity coefficient is defined as the change in conductivity (in %) per 1°C. Its default value corresponds to an increase in conductivity of 1.91%. However, it depends on temperature and ionic composition of the water, ranging between 0.0175 and 0.0214 for natural lakes and rivers. This method enables calculation of specific conductivity in a range 0 to 6000µS/cm and is valid in the temperature range -2°C to +35°C.

4.3 Speed of sound

Speed of sound in seawater is a function of salinity, temperature and pressure. The units of measurement are **m/s** (metres per second).

It is not always possible to measure the speed of sound in seawater directly. However, we can derive it from measurable properties: electrical conductivity, temperature, and pressure, obtained by your RBR*legato*³.

We derive salinity first, via the [PSS78](#) method, and then use it in the algorithm, often referred to as the UNESCO equation. See [Speed of sound in seawater as a function of salinity, temperature, and pressure](#) by G.S.K. Wong and S. Zhu for more details.

In the oceans, the speed of sound varies between 1450 and 1570m/s. It increases about 1.3m/s per each 1PSU increase in salinity, 4.5m/s per each 1°C increase in temperature, and 1.7m/s per each 1dbar increase in pressure.

4.4 Sea pressure

Sea pressure is the difference between the pressure measured underwater by your RBR*legato*³ and atmospheric pressure. The units of measurement are **dbar** (decibars).

$$\text{Sea pressure} = \text{absolute pressure} - \text{atmospheric pressure}$$

where absolute pressure (in dbar) is the value measured directly by your RBR*legato*³, and atmospheric pressure is a default value of 10.1325dbar.

4.5 Depth

Depth is a function of sea pressure and seawater density. The units of measurement are **m** (metres).

$$\text{Depth} = \frac{\text{absolute pressure} - \text{atmospheric pressure}}{\text{density} \cdot g}$$

where absolute pressure (in dbar) is the value measured directly by your RBR*legato*³, atmospheric pressure is a default value of 10.1325dbar, seawater density is a default value of 1.0281g/cm³, and *g* is the acceleration of gravity and equals 9.8m/s².

4.6 Oxygen saturation

The RBR*legato*³ supports the option of integrating the RBR*coda*³ T.ODO sensor, which measures oxygen concentration. From this measured value, we derive oxygen saturation using the Garcia and Gordon equation. See [Oxygen solubility in seawater: better fitting equations](#) by F. H. Garcia and I. I. Gordon for details. The units of measurement are **%**.

The Garcia and Gordon equation requires values for absolute temperature (in °K) and salinity, which are derived from measured temperature and conductivity.

5 Maintenance

5.1 RBRtridente safety precautions

For fDOM measurements, the RBR*tridente* uses UV LEDs (ultraviolet light emitting diodes) and should be handled with care.

Ultraviolet radiation is invisible so it may not be obvious when the instrument is active. Exercise caution to avoid any associated health risks for the eyes.

⚠ Wear approved safety glasses with side protection and UV filter lenses.
Avoid looking at the LEDs.

Storage cap

Whenever possible, keep the storage cap on your fluorometers.



RBRtridente with its storage cap on

Eye protection

If the storage cap is removed, use protective eyewear. RBR recommends UV-blocking safety glasses of the highest available rating.

Safe operation

Never look at the LEDs as their optical power (ultraviolet and visible) can be hazardous to eyes.

Whenever handling an active fluorometer, place the unit face down on a non-abrasive surface to avoid shining the light into the eyes.



RBRtridente facing down

When the fluorometer does not need to be active, disable sampling.

5.2 RBRcoda³ T.ODO care and maintenance

The RBR optical dissolved oxygen sensors have an oxygen-sensitive substrate that requires special care. Any damage will permanently affect performance.

- ⚠ Avoid direct sunlight.
- Never touch the sensitive element while cleaning or handling.
- Use the storage cap when the sensor is not in use.

Storage cap

Your RBRcoda³ T.ODO instrument comes with a specialised storage cap, designed for a sensor mounted inside the glider. This storage cap has an opening for refilling the water with a syringe.



Storage

Store the RBR optical dissolved oxygen sensor in the dedicated storage cap to protect it from damage.


Storage caps are provided with the instrument. Contact [RBR](#) if a replacement is needed.

• **Short-term storage (three weeks or less)**

1. Place the storage cap on the sensor, aligning its slanted shape with the angled optode, and gently push down until it stops.


⚠ There is a ridge inside the storage cap which prevents it from going too far and ensures there is space left for water.

2. Unscrew the luer lock cap and put it aside.
3. Fill the syringe with distilled water.
4. Insert the syringe tip in the orifice.
5. Gently push down the piston to inject until full.

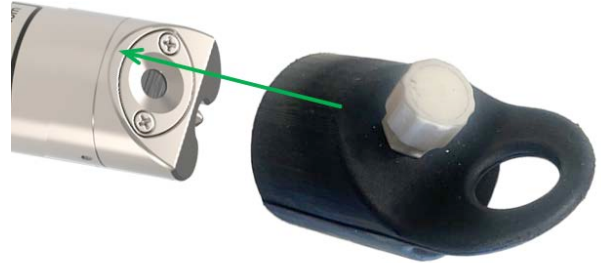

Push the storage cap until it stops

6. Remove the syringe.
7. Replace the luer lock cap.
8. Refill the water once a week during storage.

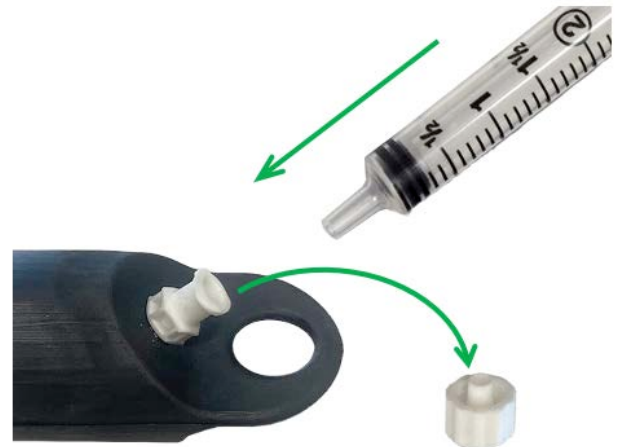

Gently push down the piston to inject until full

• **Long-term storage (more than three weeks)**

⚠ For longer storage periods, store your sensor dry. Rehydrate for **five** days before deployment.

1. Place an empty cap on the sensor and gently push down until it stops.
2. Before deployment, refill the cap with distilled water following the same steps as for short-term storage (above) and rehydrate for **five** days.

⚠ It takes up to five days for a dry ODO sensor to equilibrate after being placed in water. Insufficient hydrating time before deployment may lead to unreliable data.

First deployment

RBR ships the RBRcoda³ T.ODO instruments with a hydrated storage cap on, so that the instrument is ready for its first deployment.

However, long transportation times and low cabin pressure may cause the water to evaporate. Verify that the storage cap is still wet. If not, rehydrate the sensor for **five days** before deployment.

- ⚠ Do not exceed the maximum depth rating (6000m).
- Do not apply physical stress to the housing.
- Do not attempt to open the sensor.

For mooring or mounting applications, contact RBR for proper clamps and brackets. Improper mounting may damage the sensor.

Before any subsequent deployment, rehydrate the optode for at least **five** days.

Calibration

Check your sensor calibration before each deployment in saturated fresh water. If the readings are not within 1% of 100% saturation, recalibrate the instrument using a one-point calibration. Typically, | fast instruments may need recalibration more often than standard or | slow. See [Ruskin User Guide: Standard Instruments³](#) for user calibration instructions.

5.3 Cleaning

Clean the instrument after each extended deployment to remove deposits that may have accumulated.

Type	Procedure	Notes
General/biofouling	To clean the exterior, soak in a mild detergent, then scrub the instrument with a soft brush.	Avoid scratching the plastic (scratches make future cleaning more difficult).
Calcification	Soak in vinegar for six hours, then scrub the surface using a soft brush.	Soaking in vinegar for more than 24 hours may damage the O-ring and increase the chances of a leak.
Encrustation	Ultrasound bath	Do not use ultrasound on pressure transducers <50dbar.

Cleaning the pressure sensor

- ⚠ Avoid touching the diaphragm when cleaning the sensor! Any deformation will permanently affect performance.

1. Unscrew the sensor guard using a coin or a large flat head screwdriver. Do not apply excessive force, especially when using the screwdriver.
2. Rinse the area under running water. If this fails to remove the deposits, try soaking in vinegar or immersing in an ultrasound bath. Do not use ultrasound on pressure transducers <50dbar.
3. If unsuccessful, contact [RBR](#).



Pressure sensor of the RBR*legato*³, with the guard removed

Cleaning ODO and RBR*quadrante* sensors

When dirty, carefully wipe the sensors with a soft cloth. To remove encrustation, soak in water until soft. It may take hours or days, depending on the severity.

- ⚠ Do not use abrasive cloths as scratched faces can affect calibration.
Do not use solvents or cleaners as these could affect optical properties of the window.

Cleaning RBR*tridente*

RBR*tridente* design makes it resilient to corrosion and thus allows for more rigorous handling than other fluorimeters. See the table above for cleaning procedures.

5.4 Cables and connectors


Cable bend radius

The smallest bend radius for RBR supplied cables is 15cm.

Lubricating the connectors

Lubrication improves watertight sealing, prevents corrosion, and reduces the force required to de-mate the connector. Use the silicone compound provided with your instrument.

- Apply the silicone compound to all female connectors before every mating
- Ensure each connector hole is filled with approximately 30% lubricant

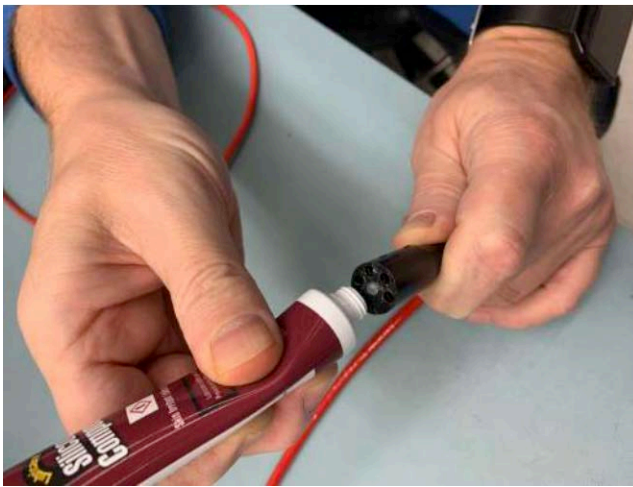

Lubricating a connector

Reducing mechanical stress

- Do not pull on the cable
- Hold onto the connector to pull out the cable
- Disconnect by pulling straight out, not at an angle
- Avoid sharp bends at the point where the cable enters the connector
- Avoid angular loads on the connector

5.5 Calibration

Factory calibration coefficients are calculated for each sensor, and the coefficients are stored on the instrument. RBR calibration certificates contain calibration equations, coefficients, and residuals for each sensor. Hard copies are provided with each shipment. RBR can replace lost or misplaced calibration certificates upon request.


RBR recommends calibrating your instrument before any critical deployment, periodically once a year, or if you suspect the readings to be out of specifications.

Discuss your calibration requirements with RBR. In some cases, the instrument will need to be returned to RBR to have it checked and recalibrated.

Please contact [RBR](#) for our current calibration fees.

5.6 Repairs

RBR supports all our products. Contact us immediately at support@rbr-global.com or via the [RBR website](#) if there are any issues with your instrument. Please have the model and the serial number of the unit ready. Our support team will work to resolve the issue remotely. In some cases, you may have to return your instrument to RBR for further servicing.

 There are no user-repairable parts of the instrument. Any attempt to repair without prior authorisation from RBR will void the warranty. Refer to the [RBR warranty statement](#).

To return a product to RBR for an upgrade, repair, or calibration, please contact our [support team](#) to obtain a return merchandise authorisation code (RMA) and review the detailed shipping information on the [RBR website](#).

6 Revision history

Revision No.	Release date	Notes
A	31-August-2021	Original
B	31-October-2021	Removed 500dbar option from pressure specifications.
C	31-January-2024	Added Sensor specifications, Derived parameters, RBR <i>codas</i> ³ T.ODO care and maintenance, RBR <i>tridente</i> safety precautions. Updated the introductory page, Physical specifications, and Cleaning.

